Cold Start Injector Time Switch (3S–GTE)

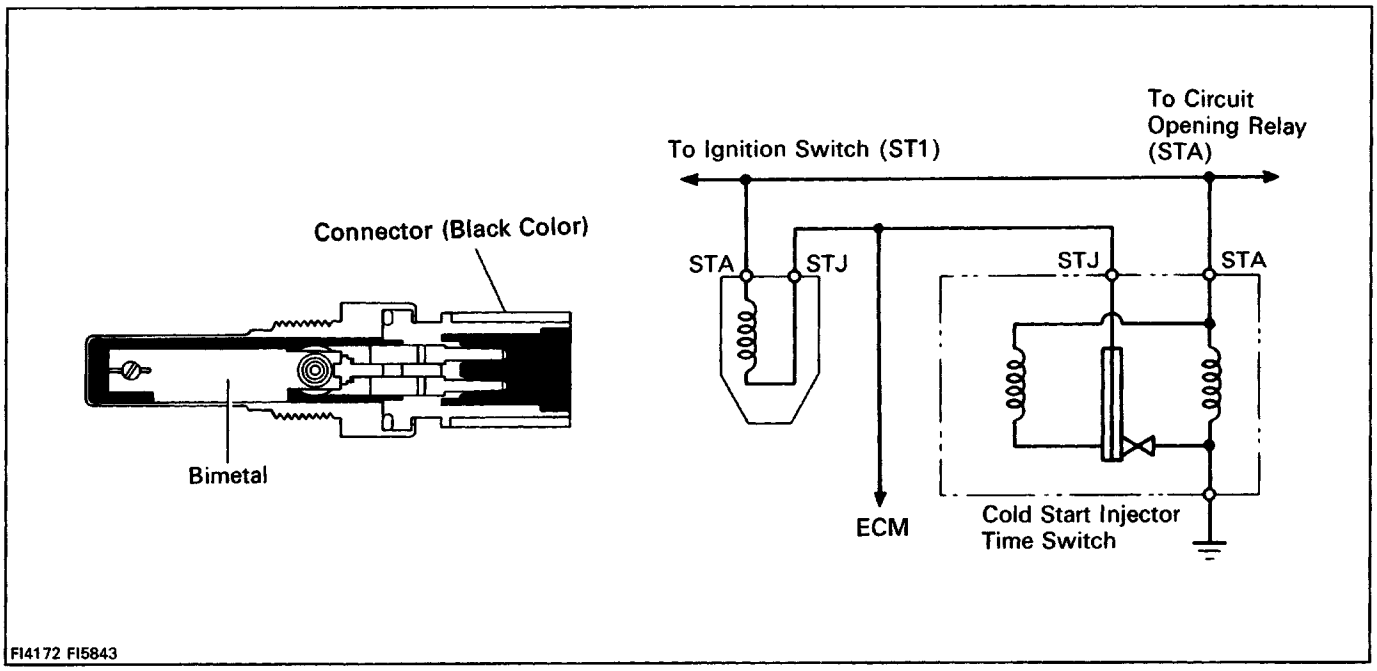

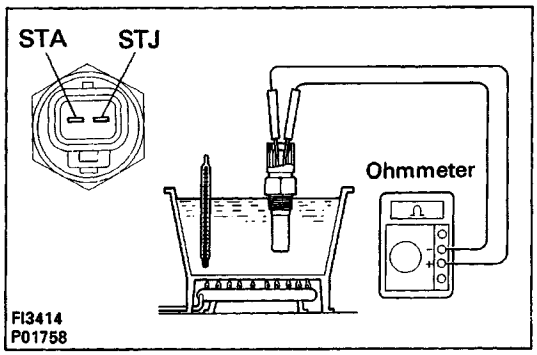

INSPECTION OF COLD START INJECTOR TIME SWITCH

INSPECT RESISTANCE OF COLD START INJECTOR TIME SWITCH

Using an ohmmeter, measure the resistance between each terminal.

Resistance:

STA – STJ	**30 – 50 Ω below 10°C (50°F)**
	70 – 90 Ω above 25°C (770F)
STA – Ground	**30–90 Ω**

If the resistance is not as specified, replace the switch.